

<b>Date</b>	<b>06/02/2020</b>
<b>Produit concerné</b>	<b>T-Bone links</b>
<b>Niveau</b>	<b>medium</b>



**KORTEL  
DESIGN**



## ***SAFETY NOTE***

### **OBJECT :**

***Non conformity of T-Bone link***

### **Description :**

In randomized tests on the strength of T-Bones links, we have just found a break at a value lower than the assumed 24KN.

After analysis, this is a production error in the manufacturing process of the T-Bones link, which is difficult to detect during routine checks.

The T-Bone links in question have a break of between 16 and 18KN.

There is therefore no immediate safety risk for solo use of T-Bone link harnesses/risers or even rescue/rescue risers.

However, due to their non-compliance with the 24KN announced, we are recalling and exchanging all T-Bone links delivered as a stand-alone product or with the Kruyer III since October 2019.


<b>Date</b>	<b>06/02/2020</b>
<b>Produit concerné</b>	<b>T-Bone links</b>
<b>Niveau</b>	<b>medium</b>



**KORTEL  
DESIGN**

For simple identification, all T-Bone links with a blue safety bartack seam, the same colour as the protective fabric, are to be considered non-compliant.

**Non-compliant**

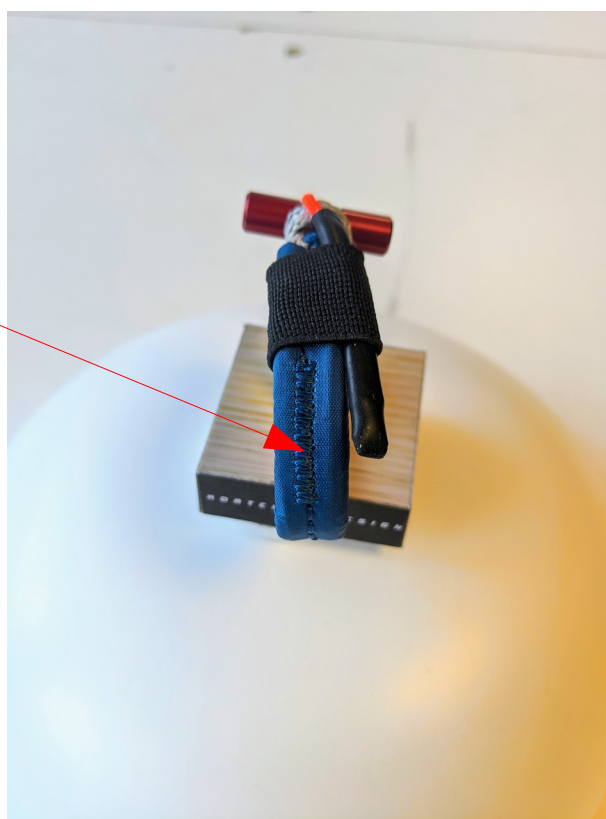

The next T-Bone links will be made with a different color bartack to identify them.